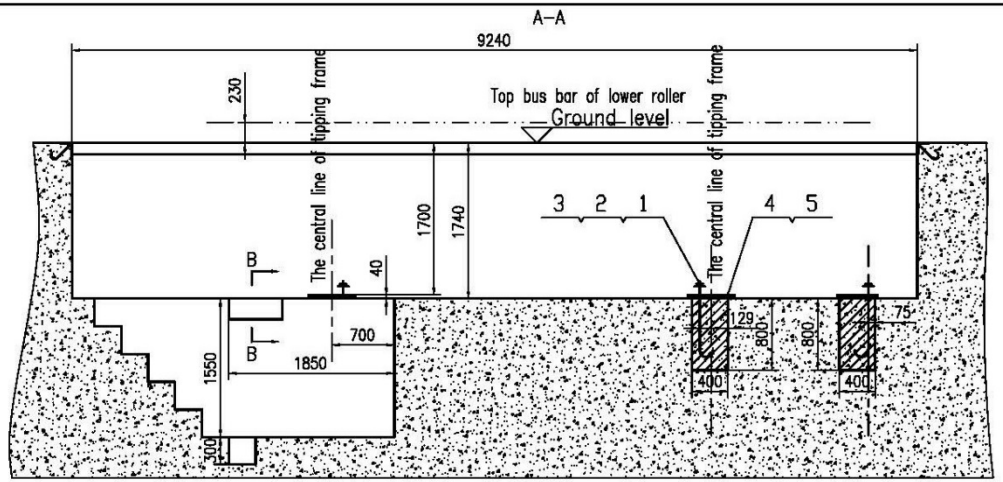

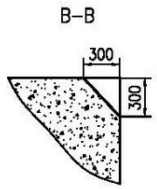

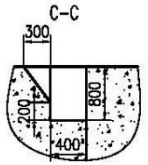

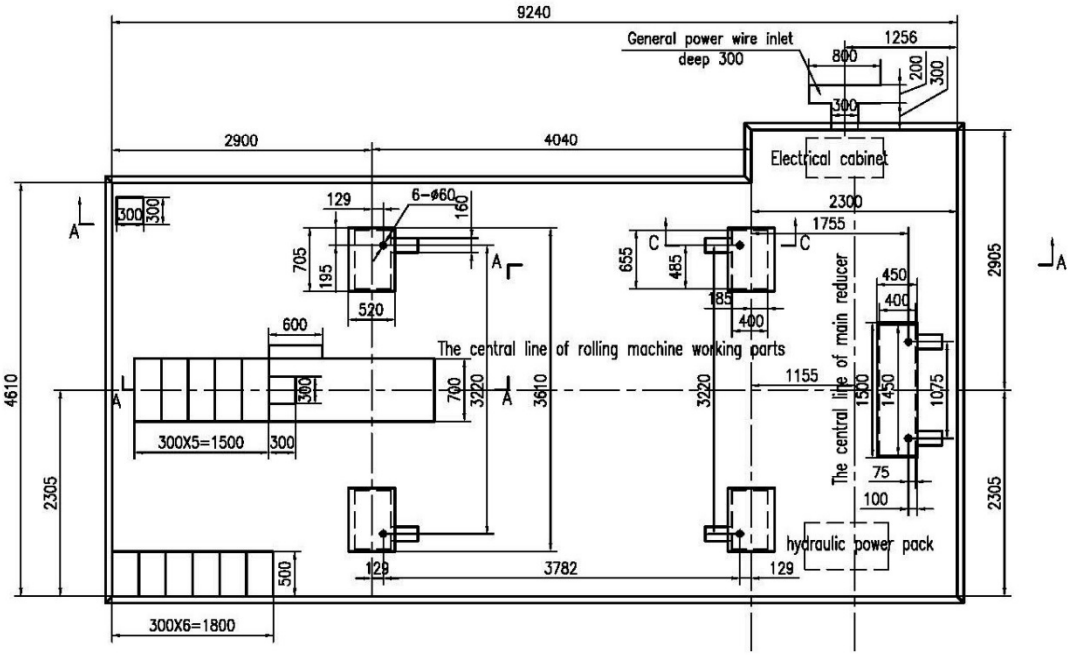

Technical requirement

1.5 pieces ø40 steel plate needed to avoid the machine contact the ground directly, please see the drawing to check the detail size and the customer need to prepare it.
2. Protection angle steel ∠50*50 should be install around the foundation and welding
3. The bottom and walls should be water–proof treated when making foundation with fixed ribs
4. When pouring the foundation, wire inlet and cabling channel for the power of electrical of control cabinet should be left
5. After machine installed, the user should install safety cover around the machine
6. The general power supply inlet wire is suggested to be BVR*90mm^2 +1*50mm^2 (PE), the length should be over 3m, independent ground wire should be left for PLC and displacement sensor.

MODEL 3R-80*3000

IRIZAR

IRIZAR HEAVY INDUSTRIES INC